

**2021 to 2024**

**Q10072103 - Samsung 980 Pro causes  
ARC-1886-6N2I RAID adapter "timeout" (300 s) at  
boot.**

Samsung NVMe SSD 980 PRO has link issue when firmware version 1B2QGXA7 works under x2 mode. Update Samsung 980 PRO firmware from 1B2QGXA7 to 2B2QGXA7 can solve the issue.

Unique solution ID: #1962

Author: Simone

Last update: 2021-03-25 11:09