

2021 to 2024

Q10022207 - SMC: CSE-826BAC4-R920LPB is installed an ARC-1886-16i with 2x Samsung PM9A3 NVMEs attached which getting lost in WebGUI after a Server-restart.

The “Int CNT1/2 NVME Link Width Config” default is “Auto” for configuring each connector 1X link lane. It needs to set CNT1/2 NVME Link Width Config” =4X.

Unique solution ID: #1986

Author: Simone

Last update: 2022-07-11 09:33