

2018 to 2020
Q10061903 - ARC-1224-8i Ver2.0 cards
downgraded to the firmware 1.54-2017-03-08, it
causes the Motherboard video outputs to not
output any video.

Since ARC-1224 uses the new flash chip from the PCB 2.0, it cannot accept the firmware old that the firmware version 1.55 date: 2018/02/20. You can make an USB-Boot stick with the good old MS-DOS, request the arcflash.exe and 12140124.bin from Areca support and flashed it to recovery it.

Unique solution ID: #1782

Author: Simone

Last update: 2020-08-25 10:44