

2021 to 2024

Q80012503 - Intel Macs always load system Areca builtin driver (ArcMSR version 1.4.2) in first priority no matter the driver you manually installed is newer or not.

Areca OS build-in driver is kernel extension. But Macs new OS no longer support kernel extensions driver update. You need to change the RAID adapter device ID using ARC1886BOOT.86 code (ID:188A->1886) and arc1883firm-id-1883.bin (ID:1880->1883), so OS will load the manually installation software extension driver downloaded from our web site instead of kernel extension similar as M1 Macs.

ARC1886BOOT.86 code (ID:188A->1886):

<https://www.areca.us/support/download/adapter/fw/ARC-1886BOOT.86.zip>

arc1883firm-id-1883.bin (ID:1880->1883):

<https://www.areca.us/support/download/adapter/fw/ARC-1883firm-id-1883.zip>

Unique solution ID: #2083

Author: Simone

Last update: 2025-03-12 08:26