

2012 to 2013

Q10051202 - For VMWare ESXI 5.0, the installation was easy, the arcmsr driver is loading but does not find any device on SuperMicro X9SCL+-F.

The problem was related to the motherboard (Supermicro X9SCL and X9SCM series).

The latest motherboard BIOS (1.1a) has an incompatibility problem with ESXI 5 when using PCI-E slot 1 (slot closer to the CPU). There were two proposed ways to solve the problem:

- 1) Revert to bios version 1.0d and use any PCI-E slot OR
- 2) Use PCI-E slot 4 with bios version 1.1a.

Unique solution ID: #1337

Author: Simone

Last update: 2022-01-06 08:27