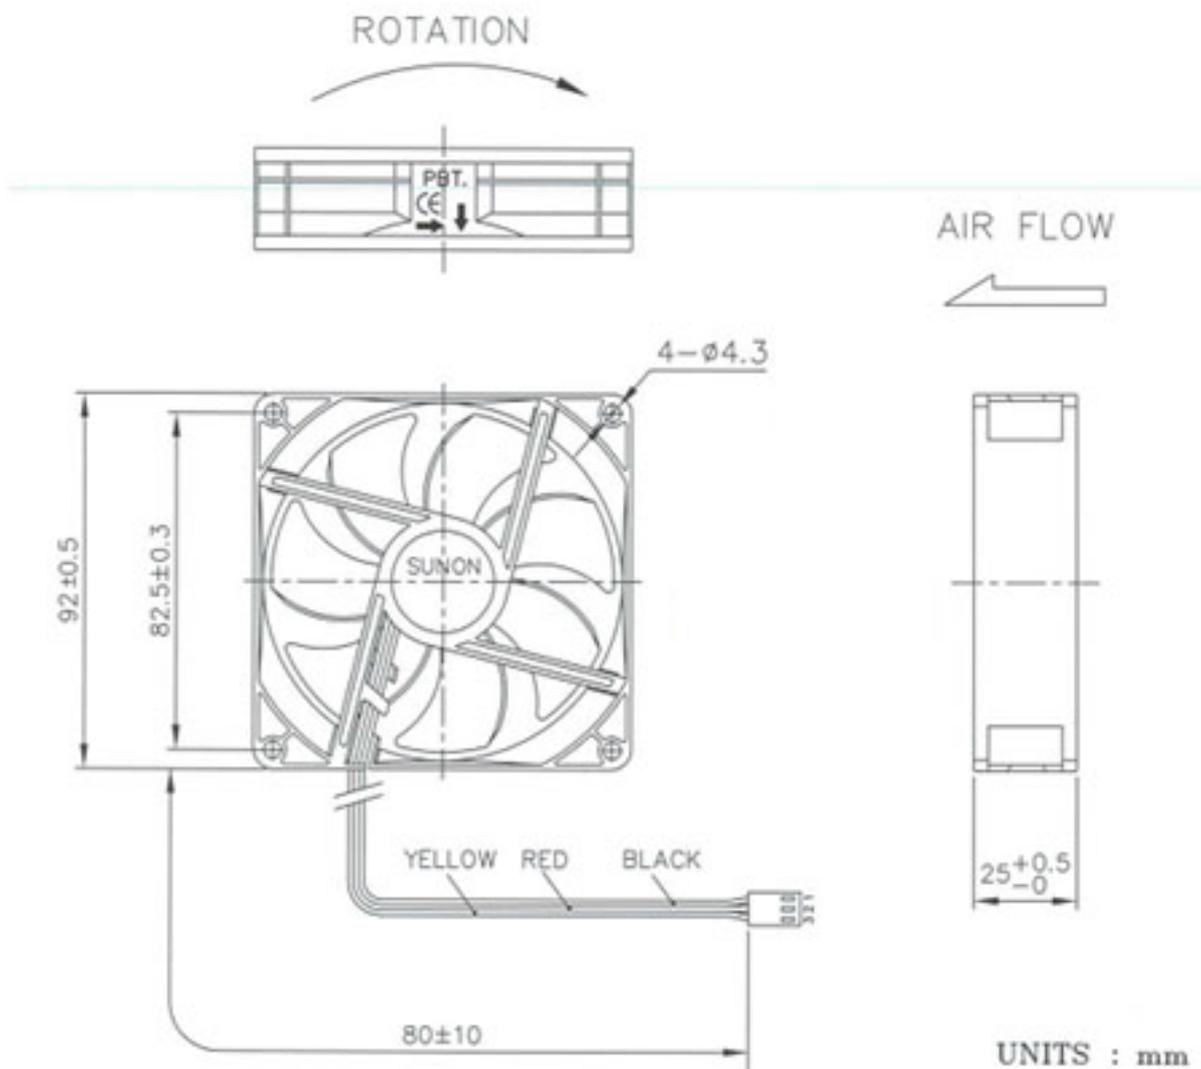# 2016 to 2020
Q80011801 - I am getting a persistent FAN #2 error on ARC-8050T2 chassis.

You can replace fan by a similar cooling fan. Since controller detects fan speed through power consumption of the fan, so please use a fan with similar (SUNON ME92251V2-0000-C99) specification.

Pendec P/N.: ME92251V2167601	
Fan Model No.	ME92251V2-0000-C99
Fan Dimension	92x92x25mm
Voltage	12 Volts
Bearing Type	Vapo Bearing System
Wire Length	80±10mm
Wire Connection	Pin1:Black Pin2:Red Pin3:Yellow
Connector Type	H-2.54-3P
Speed	2700RPM±10%
Notes:	

ROTATION

AIR FLOW

4-Ø4.3

92±0.5

82.5±0.3

SUNON

YELLOW   RED   BLACK

80±10

25+0.5−0

UNITS : mm

2016 to 2020

You can contact with our local distributor for possible replacement part. Some distributors have fan modules for customer replacement.

Distributors can be found in our web site:
http://www.areca.com.tw/wheretobuy/main.htm
 Unique solution ID: #1730
 Author: Simone
 Last update: 2022-01-06 07:24